# Long Distance Cylindrical Proximity Sensor

# **E2A3**

# Extra long distance for increased protection and sensing performance

- triple distance proximity sensors for flush mounting requirements.
- designed and tested for extra long life.



# **Ordering Information**

# DC 3-wire Models

Size	Туре	Sensing distance	Connection	Body material	Thread length	Output	Operation mode: NO	Operation mode: NC
			Pre-wired	Stainless steel	27 (40) mm	PNP	E2A3-S08KS03-WP-B1 2M	E2A3-S08KS03-WP-B2 2M
						NPN	E2A3-S08KS03-WP-C1 2M	E2A3-S08KS03-WP-C2 2M
			M12		27 (44) mm	PNP	E2A3-S08KS03-M1-B1	E2A3-S08KS03-M1-B2
M8	Shielded	3.0mm	connector	(See note.)		NPN	E2A3-S08KS03-M1-C1	E2A3-S08KS03-M1-C2
			M8	, , , , , , , , , , , , , , , , , , ,		PNP	E2A3-S08KS03-M5-B1	E2A3-S08KS03-M5-B2
		connector (3-pin) 27 (40)	27 (40) mm	NPN	E2A3-S08KS03-M5-C1	E2A3-S08KS03-M5-C2		
		d 6.0mm	Pre-wired	Brass	34 (50) mm	PNP	E2A3-M12KS06-WP-B1 2M	E2A3-M12KS06-WP-B2 2M
M12	Shielded					NPN	E2A3-M12KS06-WP-C1 2M	E2A3-M12KS06-WP-C2 2M
IVIIZ	Sillelueu		M12		34 (49) mm	PNP	E2A3-M12KS06-M1-B1	E2A3-M12KS06-M1-B2
			connector			NPN	E2A3-M12KS06-M1-C1	E2A3-M12KS06-M1-C2
			Pre-wired	Brass 39 (60) 39 (54)	39 (60) mm	PNP	E2A3-M18KS11-WP-B1 2M	E2A3-M18KS11-WP-B2 2M
M18	Shielded	11.0mm				NPN	E2A3-M18KS11-WP-C1 2M	E2A3-M18KS11-WP-C2 2M
IVITO	Silielueu		M12		30 (54) mm	PNP	E2A3-M18KS11-M1-B1	E2A3-M18KS11-M1-B2
			connector		39 (34) IIIM	NPN	E2A3-M18KS11-M1-C1	E2A3-M18KS11-M1-C2
		ed 20.0mm	Pre-wired	Droce	44 (65) mm	PNP	E2A3-M30KS20-WP-B1 2M	E2A3-M30KS20-WP-B2 2M
M30	Shielded					NPN	E2A3-M30KS20-WP-C1 2M	E2A3-M30KS20-WP-C2 2M
IVIOU	Silielded		M12	– Brass	44 (59) mm	PNP	E2A3-M30KS20-M1-B1	E2A3-M30KS20-M1-B2
			connector			NPN	E2A3-M30KS20-M1-C1	E2A3-M30KS20-M1-C2

Note: Material specifications for stainless steel housing case: 1.4305 (W.-No.), SUS303 (AISI), 2346 (SS).

# Connectivity

E2A3 Sensors are available with the following connectors and cable materials:



Standard cable lengths are 2 m and 5 m.

For other cable lengths, please contact your OMRON

representative.

Standard cable material: PVC (4-mm dia.) -WP

Model Number Legend



Example: E2A3-M12KS06-M1-B1

Triple distance, M12, standard barrel, shielded, Sn = 6 mm, M12 connector, PNP-NO

E2A3-S08KS03-WP-B1 2M Triple distance, M8 stainless steel, standard barrel, shielded, Sn = 3 mm, pre-wired PVC cable,

PNP-NO, cable length = 2 m

1. Basic name

E2A

2. Sensing technology

Standard double distance

Triple distance

3. Housing shape and material

M: Cylindrical, metric threaded, brass

S: Cylindrical, metric threaded, stainless steel

4. Housing size

08: 8 mm 12 mm 12: 18: 18 mm 30: 30 mm

5. Barrel length

Standard length K: Long body L:

6. Shield

S: Shielded N: Non-shielded

7. Sensing distance

Numeral: Sensing distance: e.g., 03 = 3 mm, 11 = 11 mm

**Connector Models** 



Standard connectors: M12, M8 (3-pin)

-M1, -M5

8. Kind of connection

Pre-wired, PVC, 4-mm dia. WP: M1: M12 connector (4-pin) \* M8 connector (3-pin)

9. Power source and output

B: DC, 3-wire, PNP open collector DC, 3-wire, NPN open collector C:

10.Operation mode

1: Normally open (NO) 2: Normally closed (NC)

11. Specials (e.g., cable material, oscillating frequency)

12.Cable length

Connector Model Blank: Numeral: Cable length

D-36 Inductive Sensors

# **Specifications**

# DC 3-wire Models


	Size	M8	M12	M18	M30		
Туре		Shielded	Shielded	Shielded	Shielded		
Item		E2A3-S08KS03-□□-B□ E2A3-S08KS03-□□-C□	E2A3-M12KS06-□□-B□ E2A3-M12KS06-□□-C□	E2A3-M18KS11-□□-B□ E2A3-M18KS11-□□-C□	E2A3-M30KS20-□□-B□ E2A3-M30KS20-□□-C□		
Sensing distance		3 mm ± 10%	6 mm ± 10%	11 mm ± 10%	20 mm ± 10%		
Setting	Ambient temp. of -25 to 70°C	0 to 2.1 mm	0 to 4.2 mm	0 to 7.7 mm	0 to 14 mm		
distance	Ambient temp. of -10 to 60°C	0 to 2.4 mm	0 to 4.8 mm	0 to 8.8 mm	0 to 16 mm		
Differential trave	el	20% max. of sensing distance					
Target		Ferrous metal (The sensin	g distance decreases with	non-ferrous metal.)			
Standard sensir	ng object	$9 \times 9 \times 1 \text{ mm}$	18 × 18 × 1 mm	$33 \times 33 \times 1 \text{ mm}$	60 × 60 × 1 mm		
Response frequ	uency (See note 1.)	700 Hz	350 Hz	250 Hz	80 Hz		
Power supply voltage (operating voltage)	oltage ige range)	12 to 24 VDC. Ripple (p-p) (10 to 32 VDC)	): 10% max.				
Current consum	nption	10 mA max.					
Output type		-B models: PNP open colle -C models: NPN open colle					
Control output	Load current	200 mA max. (32 VDC ma	x.)				
Control output	Residual voltage	2 V max. (under load curre	ent of 200 mA with cable ler	ngth of 2 m)			
Indicator		Operation indicator (Yellow LED)					
Operation mode	Э	-B1/-C1 models: NO -B2/-C2 models: NC For details, refer to the timing charts.					
Protection circuits		Power source circuit reverse polarity protection, Surge suppressor, Short-circuit protection  Output reverse polarity protection, Power source circuit reverse polarity protection, Surge suppressor, Short-circuit protection					
Ambient air tem	perature	Operating: -25°C to 70°C,	Storage: -25°C to 70°C				
Temperature in	fluence	±20% max. of sensing distance at 23°C within temperature range of –25°C to 70°C –10% to +20% of sensing distance at 23°C within temperature range of –10°C to 60°C					
Ambient humidi	ty	Operating: 35% to 95%, Storage: 35% to 95%					
Voltage influend	ce	±1% max. of sensing distance in rated voltage range ±15%					
Insulation resist	ance	50 MΩ min. (at 500 VDC) between current-carrying parts and case					
Dielectric strenç	gth	1,000 VAC at 50/60 Hz for 1 min between current-carrying parts and case					
Vibration resista	ance	10 to 55 Hz, 1.5-mm double amplitude for 2 hours each in X, Y, and Z directions					
Shock resistance	е	500 m/s², 10 times each in X, Y, and Z directions					
Standards and listings (See note 2.)		IP67 after IEC 60529 IP69K after DIN 40050 EMC after EN60947-5-2					
Connection method		-WP models: Pre-wired Models (4-mm dia. PVC cable with length of 2 m) -M1 models: M12 4-pin Connector Models -M5 models: M8 3-pin Connector Models					
Weight	Pre-wired Models	Approx. 65 g	Approx. 85 g	Approx. 160 g	Approx. 280 g		
(packed state)	Connector Models	M12 Connector Models: Approx. 20 g	Approx. 35 g	Approx. 70 g	Approx. 200 g		
	Case	Stainless steel	Brass-nickel plated				
Material	Sensing surface	PBT					
iviaitilai	Cable	PVC					
ŀ	Clamping nut	Stainless steel Brass-nickel plated					

Note 1. The response frequency is an average value. Measurement conditions are as follows: standard sensing object, a distance of twice the standard sensing object length between sensing objects, and a set distance of half the sensing distance.

2. For USA and Canada: use class 2 circuit only.


# **Engineering Data**

# Operating Range (Typical)

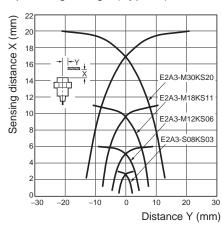


# Influence of Sensing Object Size and Materials


# E2A3-S08KS03

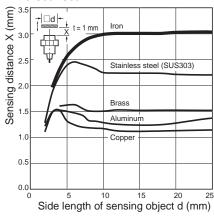


# E2A3-M12KS06

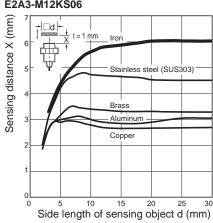

E2A3-M18KS11

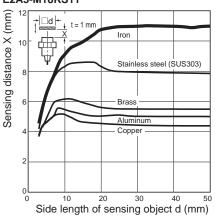

# E2A3-M30KS20

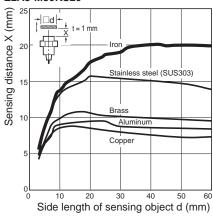


D-38 **Inductive Sensors** 

# Operation

# DC 3-wire Models

PNP Output

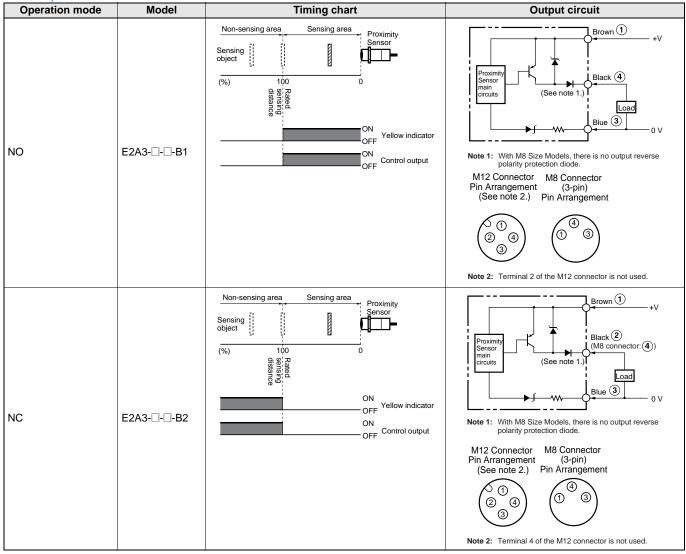

# DC 3-wire Models

NPN Output

Operation mode	Model	Timing chart	Output circuit
NO	E2A3-□-□-C1	Non-sensing area  Sensing Sensing area  Sensing Sensor  (%)  100  Rate Sensor  ON OFF  Yellow indicator OFF  Control output	Note 1: With M8 Size Models, there is no output reverse polarity protection diode.  M12 Connector M8 Connector Pin Arrangement (3-pin) (See note 2.) Pin Arrangement (3-pin) (See Terminal 2 of the M12 connector is not used.
NC	E2A3-□-□-C2	Non-sensing area  Sensing area  Sensing area  Proximity Sensor  Sensor  ON OFF  Yellow indicator ON OFF  Control output	Note 1: With M8 Size Models, there is no output reverse polarity protection diode.  M12 Connector M8 Connector (3-pin) (See note 2.) Pin Arrangement (See note 2.) Pin Arrangement  (3-pin) (3-pin) (3-pin) (3-pin) (4-1) (1-1

D-40 Inductive Sensors

# **Dimensions**


Note: All units are in millimeters unless otherwise indicated.

#### **Pre-wired Models**



# E2A3-S08KS03-WP-□□






Note 1. 4-dia. vinyl-insulated round cable with 3 conductors (Conductor cross section: 0.3 mm²; Insulator diameter: 1.3 mm),
Standard length: 2 m

2. Operation indicator (yellow)

#### E2A3-M12KS06-WP-





Note 1. 4-dia. vinyl-insulated round cable with 3 conductors (Conductor cross section: 0.3 mm²; Insulator diameter: 1.3 mm),
Standard length: 2 m


2. Operation indicator (yellow)

# **M12 Connector Models**



# E2A3-S08KS03-M1-






Note: Operation indicator (yellow LED, 4×90°)

# E2A3-M12KS06-M1-






Note: Operation indicator (yellow LED, 4×90°)

#### E2A3-M18KS11-WP-□□







Note 1. 4-dia. vinyl-insulated round cable with 3 conductors (Conductor cross section: 0.3 mm²; Insulator diameter: 1.3 mm), Standard length: 2 m

2. Operation indicator (yellow)

# E2A3-M30KS20-WP-



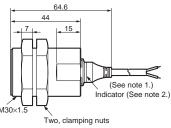


Note 1. 4-dia. vinyl-insulated round cable with 3 conductors (Conductor cross section: 0.3 mm²; Insulator diameter: 1.3 mm),
Standard length: 2 m

2. Operation indicator (yellow)


# E2A3-M18KS11-M1-





Note: Operation indicator (yellow LED, 4×90°)

# E2A3-M30KS20-M1-

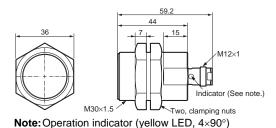


# **M8 Connector Models**



# E2A3-S08KS03-M5-□□





Note: Operation indicator (yellow LED,  $4\times90^{\circ}$ )

# **Mounting Hole Cutout Dimensions**



External diameter of Proximity Sensor	Dimension F (mm	
M8	8.5 dia. <sup>+0.5</sup>	
M12	12.5 dia. <sup>+0.5</sup>	
M18	18.5 dia. <sup>+0.5</sup>	
M30	30.5 dia. <sup>+0.5</sup>	

D-42 Inductive Sensors

# **Safety Precautions**

# Precautions for Safe Use

# / WARNING

This product is not designed or rated for ensuring safety of persons.

Do not it for such purposes.

# $\bigcirc$

#### **Power Supply**

Do not impose an excessive voltage on the E2A3, otherwise it may be damaged. Do not impose AC current (100 to 240 VAC) on any DC Model, otherwise it may be damaged.

#### **Load Short-circuit**

Do not short-circuit the load, or the E2A3 may be damaged.

The E2A3's short-circuit protection function will be valid if the polarity of the supply voltage is correct and within the rated voltage range.

#### Wiring

Be sure to wire the E2A3 and load correctly, otherwise it may be damaged.

#### **Connection with No Load**

Be sure to insert a load when wiring. Make sure to connect a proper load to the E2A3 during operation, otherwise it may damage internal elements.

Do not expose the product to flammable or explosive gases.

Do not disassemble, repair, or modify the product.

#### Precautions for Correct Use


#### Designing

#### **Power Reset Time**

The Proximity Sensor is ready to operate within 100 ms after power is supplied. If separate power supplies are connected to the Proximity Sensor and load, be sure to supply power to the Proximity Sensor before supplying power to the load.

#### **Effects of Surrounding Metal**

When mounting the E2A3 within a metal panel, ensure that the clearances given in the following tables are maintained.




(Unit: mm)

	Dimension N		18	M12	
Model	Material of surrounding metal	Ferrous metal	Non- ferrous metal	Ferrous metal	Non- ferrous metal
	I	0.5 (*)	2 (*)	2 (*)	1 (*)
	m	9		18	
E2A3 Shielded	d	24		36	
	D	0.5	2	2	1
	n	24		36	

(Unit: mm)

	Dimension	Dimension M18		M30	
Model	Material of surrounding metal	Ferrous metal	Non- ferrous metal	Ferrous metal	Non- ferrous metal
	I	4 (*)	2.5 (*)	6 (*)	4 (*)
	m	33		60	
E2A3 Shielded	d	54		90	
S	D	4	2.5	6	4
	n	54		90	

<sup>\*</sup> Using the nuts provided with the E2A3 allows mounting in the way shown below.



#### **Power OFF**


The Proximity Sensor may output a pulse signal when it is turned OFF. Therefore, it is recommended that the load be turned OFF before turning OFF the Proximity Sensor.

#### **Power Supply Transformer**

When using a DC power supply, make sure that the DC power supply has an insulated transformer. Do not use a DC power supply with an auto-transformer.

#### **Mutual Interference**

When installing two or more Sensors face-to-face or side-by-side, ensure that the minimum distances given in the following table are maintained.



(Unit: mm)

Type	Dimension	M8	M12	M18	M30
Shielded	Α	25	35	70	110
Silielded	В	20	25	45	70

#### Wiring

#### **High-tension Lines**

Wiring through Metal Conduit:

If there is a power or high-tension line near the cable of the Proximity Sensor, wire the cable through an independent metal conduit to prevent against Proximity Sensor damage or malfunctioning.

#### Cable Extension

The standard cable length is less than 200 m.

The tractive force is 50 N.

#### Mounting

The Proximity Sensor must not be subjected to excessive shock with a hammer when it is installed, otherwise the Proximity Sensor may be damaged or lose its water-resistance.

Do not tighten the nut with excessive force. A washer must be used with the nut.



	Туре	Torque
M8	Stainless Steel Model	9 N·m
	Brass Model	
M12		20 N·m
M18		60 N·m
M30		150 N·m

#### **Maintenance and Inspection**

Periodically perform the following checks to ensure stable operation of the Proximity Sensor over a long period of time.

- Check for mounting position, dislocation, looseness, or distortion of the Proximity Sensor and sensing objects.
- 2. Check for loose wiring and connections, improper contacts, and line breakage.
- 3. Check for attachment or accumulation of metal powder or dust.
- Check for abnormal temperature conditions and other environmental conditions.
- Check for proper lighting of indicators (for models with a set indicator).

Never attempt to disassemble or repair the Sensor.

#### **Environment**

#### Water Resistivity

The Proximity Sensors are tested intensively on water resistance, but to ensure maximum performance and life expectancy, avoid immersion in water and provide protection from rain or snow.

#### **Operating Environment**

Store and operate the Proximity Sensor only within the given specifications.

#### **Inrush Current**

A load that has a large inrush current (e.g., a lamp or motor) will damage the Proximity Sensor. Connect the load to the Proximity Sensor through a relay.

#### <SUITABILITY FOR USE>

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of the products in the customer's application or use of the products.

Take all necessary steps to determine the suitability of the product for the systems, machines, and equipment with which it will be used.

#### <CHANGE IN SPECIFICATIONS>

Product specifications and accessories may be changed at any time based on improvements and other reasons. Consult with your OMRON representative at any time to confirm actual specifications of purchased product.

ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.

To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.

Cat. No. D102-E2-01A-X

In the interest of product improvement, specifications are subject to change without notice.

D-44 Inductive Sensors